

Safety Advice



everyone
home safe
every day

GreenMech Woodchippers

Issued to: All Network Rail line managers,
safety professionals and accredited contractors

Ref: NRA23-09

Date of issue: 16/08/2023

Location: National

Contact: [John Watt, Senior Engineer, TA](mailto:John.Watt@greenmech.co.uk)



Overview

A number of GreenMech Woodchippers, EVO 205D SAFE and SURE-Trak models have left the factory without the Engine Harness Support Bracket being fitted.

GreenMech have now created a new bracket for retrofit, along with a new Over Centre Valve Mount which needs to be fitted in order to accommodate the new bracket and revised wiring loom position.

Owners of any models should carry out an inspection and confirm if retrofit work needs to be undertaken. You can order the part numbers as specified below and claim back the cost under GreenMech.


Warranty procedures. Questions should be directed to the Service Department: support@greenmech.co.uk or 01789 400044 Option 2.



Harness



New position of over centre valve

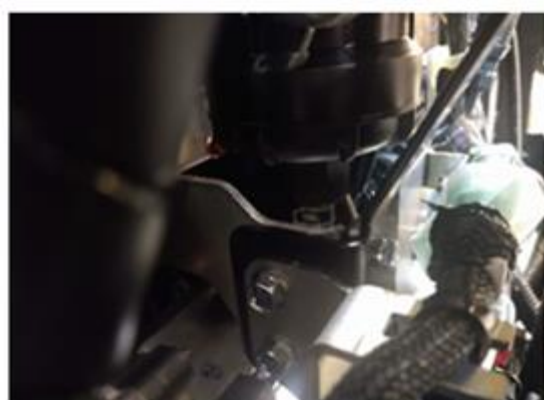

Bracket



Old position of over centre valve

Immediate action required

1. Inspect EVO 205D SAFE and SURE-Trak models and confirm if retrofit work needs to be undertaken.
2. If work needs to be undertaken, parts should be ordered under:
 - ▶ Engine Harness Support Bracket – 4038913
 - ▶ Track Leg, Over Centre Valve Mount - 4038922
3. Any issues or questions should be directed to Service Department support@greenmech.co.uk or 01789 400044 Option 2.

Part of our group
of Safety Bulletins

Safety
Alert

Safety
Bulletin

Safety
Advice

Shared
Learning